

4-Digit Multi Panel Meters

MT4W Series  
INSTRUCTION MANUAL

TCD220015AG

Autonics

Thank you for choosing our Autonics product.

Read and understand the instruction manual and manual thoroughly before using the product.

For your safety, read and follow the below safety considerations before using.

For your safety, read and follow the considerations written in the instruction manual, other manuals and Autonics website.

Keep this instruction manual in a place where you can find easily.

The specifications, dimensions, etc. are subject to change without notice for product improvement. Some models may be discontinued without notice.

Follow Autonics website for the latest information.

Safety Considerations

- Observe all ‘Safety Considerations’ for safe and proper operation to avoid hazards.
- ⚠ symbol indicates caution due to special circumstances in which hazards may occur.

⚠ Warning

Failure to follow instructions may result in serious injury or death.

01. Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss. (e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime / disaster prevention devices, etc.)

Failure to follow this instruction may result in personal injury, economic loss or fire.

02. Do not use the unit in the place where flammable / explosive / corrosive gas, high humidity, direct sunlight, radiant heat, vibration, impact or salinity may be present.

Failure to follow this instruction may result in explosion or fire.

03. Install on a device panel to use.

Failure to follow this instruction may result in fire or electric shock.

04. Do not connect, repair, or inspect the unit while connected to a power source.

Failure to follow this instruction may result in fire or electric shock.

05. Check ‘Connections’ before wiring.

Failure to follow this instruction may result in fire.

06. Do not disassemble or modify the unit.

Failure to follow this instruction may result in fire or electric shock.

⚠ Caution

Failure to follow instructions may result in injury or product damage.

01. When connecting the power / measurement input and relay output, use AWG 24 (0.20 mm<sup>2</sup>) to AWG 15 (1.65 mm<sup>2</sup>) cable or over and tighten the terminal screw with a tightening torque of 0.98 to 1.18 N m. Use the wiring suitable for the load current capacity.
- Failure to follow this instruction may result in fire or malfunction due to contact failure.
02. Use the unit within the rated specifications.
- Failure to follow this instruction may result in fire or product damage.
03. Use a dry cloth to clean the unit, and do not use water or organic solvent.
- Failure to follow this instruction may result in fire or electric shock.
04. Keep the product away from metal chip, dust, and wire residue which flow into the unit.
- Failure to follow this instruction may result in fire or product damage.

Cautions during Use

- Follow instructions in ‘Cautions during Use’.
- Otherwise, It may cause unexpected accidents.
- Power supply should be insulated and limited voltage / current or Class 2, SELV power supply device.
- Install a power switch or circuit breaker in the easily accessible place for supplying or disconnecting the power.
- Use twisted pair wire for communication line.
- Keep away from high voltage lines or power lines to prevent inductive noise.

 
In case installing power line and input signal line closely, use line filter or varistor at power line and shielded wire at input signal line.

 
Do not use near the equipment which generates strong magnetic force or high frequency noise.

Connection with the line filter

Connection with the varistor

Install the line filter close to the panel meter





- This unit may be used in the following environments.
- Indoors (in the environment condition rated in ‘Specifications’)
- Altitude max. 2,000 m
- Pollution degree 2
- Installation category II

Ordering Information

This is only for reference, the actual product does not support all combinations.

For selecting the specified model, follow the Autonics website.

MT 4 W - ① - ② ③

① Input type

DV: DC voltage<sup>01)</sup>

DA: DC current

AV: AC voltage<sup>02)</sup>

AA: AC current<sup>02)</sup>

② Power supply

1: 12 - 24 VDC ± 10 %

4: 100 - 240 VAC ± 10 % 50 / 60 Hz

③ Preset output + Sub output

	Preset output	Sub output
N	None (indicator)	
0	Relay	Transmission (DC 4 - 20 mA)
1	Relay	-
2	NPN open collector	BCD Dynamic
3	PNP open collector	BCD Dynamic
4	NPN open collector	Transmission (DC 4 - 20 mA)
5	PNP open collector	Transmission (DC 4 - 20 mA)
6	NPN open collector	Low speed serial
7	PNP open collector	Low speed serial
8	NPN open collector	RS485 Communication
9	PNP open collector	RS485 Communication

01)

To measure the current over DC 5 A, please select DV type because the shunt should be used.

02)

In case of selecting frequency display, no output will be provided even if it is output support model.

Product Components

- Product
- Bracket × 2

- Instruction manual
- Unit sticker × 1

Sold Separately

- Terminal protection cover: M6P / M9P-COVER

Software

Download the installation file and the manuals from the Autonics website.


■ DAQMaster


It is the comprehensive device management program for Autonics’ products, providing parameter setting, monitoring and data management.

Dimensions


- Unit: mm, For the detailed drawings, follow the Autonics website.


■ Indicator / Relay preset output model

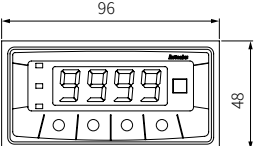

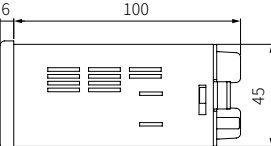



■ NPN / PNP open collector preset output model

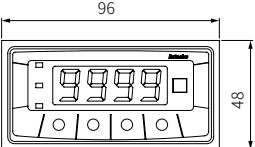

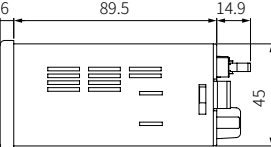

■ Bracket

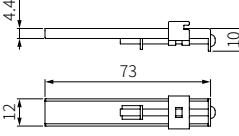


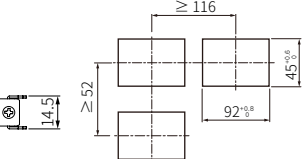


Cautions during Wiring

Use the Copper-conductor wire with the temperature class 60 °C.

 - Unit: mm, Use terminals of size specified below.
- Contact the manufacture for the socket and cable.

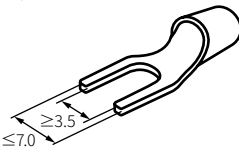





Connections

■ Input


• DC voltage

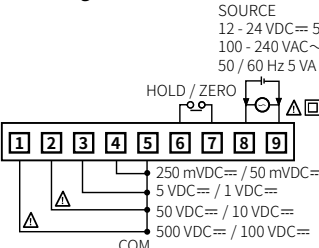


• DC current

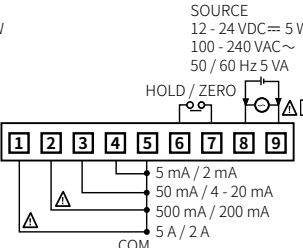

• AC voltage

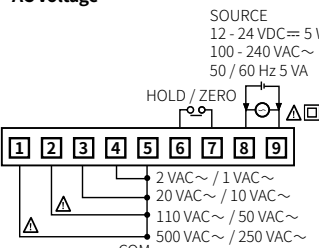


• AC current

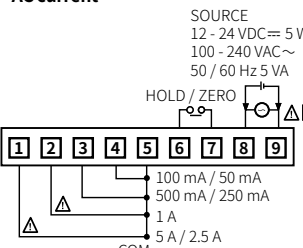

■ Output


• 0: Relay + Transmission (DC 4 - 20 mA)

 Main OUT  
Contact OUT: 250 VAC ~ 3A 1a DC 4 - 20 mA resistive load Load 600 Ω Max.




• 1: Relay

 Main OUT  
Contact OUT: 250 VAC ~ 3A 1a resistive load




• 2: NPN open collector + BCD Dynamic

Main OUT: NPN open collector 12 - 24 VDC ≈ Max. 50 mA

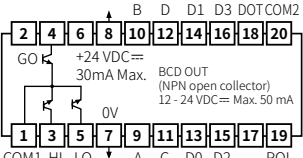


• 3: PNP open collector + BCD Dynamic

Main OUT: PNP open collector 12 - 24 VDC ≈ Max. 50 mA

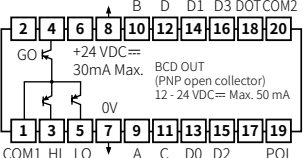


• 4: NPN open collector + Transmission (DC 4 - 20 mA)

Main OUT: NPN open collector 12 - 24 VDC ≈ Max. 50 mA

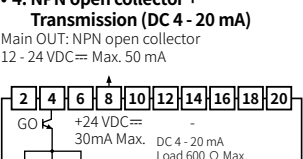


• 5: PNP open collector + Transmission (DC 4 - 20 mA)

Main OUT: PNP open collector 12 - 24 VDC ≈ Max. 50 mA

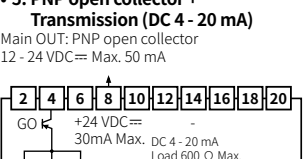


• 6: NPN open collector + Low speed serial

Main OUT: NPN open collector 12 - 24 VDC ≈ Max. 50 mA

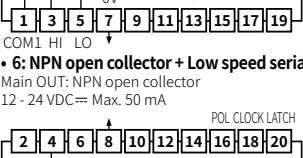


• 7: PNP open collector + Low speed serial

Main OUT: PNP open collector 12 - 24 VDC ≈ Max. 50 mA

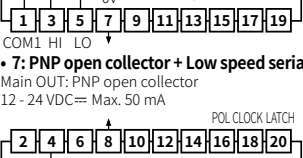


• 8: NPN open collector + RS485 Comm.

Main OUT: NPN open collector 12 - 24 VDC ≈ Max. 50 mA

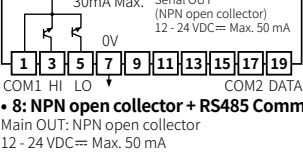



• 9: PNP open collector + RS485 Comm.

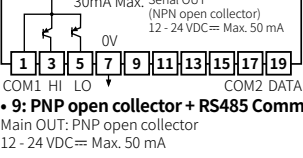Main OUT: PNP open collector 12 - 24 VDC ≈ Max. 50 mA



Specifications

Model	MT4W-DV-□□	MT4W-DA-□□	MT4W-AV-□□	MT4W-AA-□□
Input type	DC voltage	DC current	AC voltage <sup>01)</sup>	AC current <sup>01)</sup>
Max. allowable input	Dependent on the input type			
DC input	-5 to 110 % F.S. for each measured input range			
AC input	10 to 110 % F.S. for each measured input range			
Display method	7-segment (red) LED (character height: 14.2 mm)			
Display accuracy	Dependent on the ambient temperature			
23 ± 5 °C	± 0.1 % F.S. rdg ± 2 digit <sup>02)</sup>		± 0.3 % F.S. rdg ± 3 digit	
-10 to 50 °C	± 0.5 % F.S. rdg ± 3 digit			
Max. display range	-1999 to 9999 (4 digit)			
A / D conversion method	ΣΔ (Sigma Delta) ADC			
Sampling cycle	50 ms		16.6 ms	
Protection rating	IP56 (front part, IEC standard)			
Unit weight (packaged)	≈ 211 g (≈ 326 g)			
Certification	CE UK   <sup>03)</sup> ENEC <sup>04)</sup>			

01) Available frequency display, Display accuracy (23 ± 5 °C): ± 0.1 % F.S. rdg ± 2 digit

02) 5 A terminal: ± 0.3 % F.S. rdg ± 3 digit

03) Except MT4W-□-1□ model

04) Except MT4W-DA-19 and MT4W-DV/AV-1□ model

Preset output	None (indicator) / Relay / NPN open collector / PNP open collector output model
Relay	Contact capacity: 250 VAC ~ 3 A, 30 VDC ≈ 3 A Contact composition: N.O (1a)
NPN / PNP open collector	Output capacity: ≤ 12 - 24 VDC ≈ ± 2 VDC ≈, 50 mA resistive load
Sub output	None (indicator) / BCD Dynamic / Transmission (DC 4 - 20 mA) / Low speed serial / RS485 Communication output model
BCD Dynamic / Low speed serial	NPN open collector output Output capacity: ≤ 12 - 24 VDC ≈, 50 mA resistive load
Transmission (DC 4 - 20 mA)	Resolution: 1/12,000 (load resistance: ≤ 600 Ω) Response time <sup>01)</sup> : ≤ 550 ms Output accuracy (23 ± 5 °C): ± 0.3 % F.S.
RS485 communication	Protocol: Modbus RTU

01) Based on the display cycle of 0.2 seconds.


Deviations may occur depending on the device environment and the display cycle of the product.

Response time: Time taken to proportional output to the rapidly changing input from 15 → 95 % or 95 → 15 %.

Model	MT4W-□-1□	MT4W-□-4□
Power supply	12 - 24 VDC ≈	100 - 240 VAC ~ 50 / 60 Hz
Permissible voltage range	90 to 110 % of rated voltage	
Power consumption	3 W <sup>01)</sup>	5 VA
Insulation resistance	Between external terminal and case: ≥ 100 MΩ (500 VDC ≈ megger)	
Dielectric strength	Between the charging part and the case : 2,000 VAC ~ 50 / 60 Hz for 1 min	Between the charging part and the case : 3,000 VAC ~ 50 / 60 Hz for 1 min
Noise immunity	± 500 V square wave noise (pulse width: 1 μs) by the noise simulator	± 2 kV square wave noise (pulse width: 1 μs) by the noise simulator
Vibration	0.75 mm double amplitude at frequency of 10 to 55 Hz in each X, Y, Z direction for 2 hours	
Vibration (malfunction)	0.5 mm double amplitude at frequency of 10 to 55 Hz in each X, Y, Z direction for 10 min	
Shock	300 m/s <sup>2</sup> (≈ 30 G) in each X, Y, Z direction for 3 times	
Shock (malfunction)	100 m/s <sup>2</sup> (≈ 10 G) in each X, Y, Z direction for 3 times	
Relay life cycle	Mechanical: ≥ 20,000,000 operations Electrical: ≥ 100,000 operations (250 VAC ~ 3A resistive load)	
Ambient temp.	-10 to 50 °C, storage: -20 to 60 °C (freezing or condensation)	
Ambient humi.	35 to 85 %RH, storage: 35 to 85 %RH (freezing or condensation)	
Insulation type	Symbol: □, double or reinforced insulation (dielectric strength between the measurement input part and the power part: 1 kV)	

01) Except MT4W-□-15:5 W

Communication Interface	
■ RS485	
Comm. protocol	Modbus RTU
Application standard	Compliance with EIA RS485
Max. connection	31 units (address: 01 to 99)
Comm. synchronous method	Asynchronous
Comm. method	2-wire half duplex
Comm. distance	≤ 800 m
Comm. speed	1,200 / 1,400 / 4,800 / 9,600 / 19,200 / 38,400 bps
Start bit	1-bit (fixed)
Data bit	8-bit (fixed)
Parity bit	None, Even, Odd
Stop bit	1-bit, 2-bit
EEPROM life cycle	≈ 1,000,000 operations (Erase / Write)

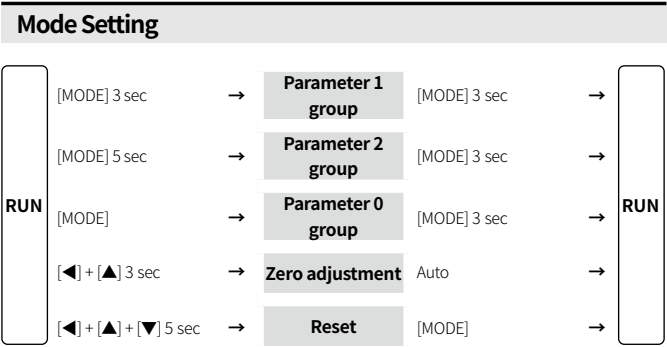

- Parameter Setting
- Some parameters are activated / deactivated depending on the model or setting of other parameters. Refer to the description of each parameter.
  - If any key is not entered for 60 sec in each parameter, it returns to RUN mode.
  - After returning to RUN mode, press the [MODE] key within 2 sec, it returns to previous parameter.
  - [MODE] key: Saves current setting value and moves to the next parameter.
  - [◀] key: Checks fixed value / Changes setting digits.
  - [▲], [▼] key: Changes setting values.

Parameter 1 group				
Parameter	Mark	Defaults	Setting range	Display condition
1-1 Input range	I n r	5000	[DC voltage model], [AC voltage model] • Refer to Input Range and Display Range	-
		5R	[DC current model], [AC current model] • Refer to Input Range and Display Range	-
1-2 Display method	d i S P	5 t n d	STND: standard, SCAL: scale, FREQ: frequency <sup>01)</sup>	-
1-3 Measurement method	I n t	5 r n 5	[AC voltage model], [AC current model] T.RMS: True RMS, A.RMS: Average RMS, AVG • True RMS = $\sqrt{\frac{A_1^2 + A_2^2 + \dots + A_n^2}{n}}$ • Average RMS = $\frac{A_1 + A_2 + \dots + A_n}{n}$ × Waveform rate (n = number of display values per cycle, A = display value)	1-2 Display method: STND, SCAL
		00	[DC voltage model], [AC voltage model] 0, 0.0, 0.00, 0.000	1-2 Display method: SCAL
1-4 Decimal point position	d o t	0.000	[DC current model], [AC current model] 0, 0.0, 0.00, 0.000	1-2 Display method: SCAL
		0	[AC voltage model], [AC current model] <sup>02)</sup> 0, 0.0, 0.00, 0.000	1-2 Display method: FREQ
1-5 High-limit scale <sup>02)</sup>	H - 5 C	-	-1999 to 9999 • Display value against max. measurement input	1-2 Display method: SCAL
1-6 Low-limit scale <sup>02)</sup>	L - 5 C	-	-1999 to 9999 • Display value against min. measurement input	
1-7 High-limit display value gradient correction	I n b H	1000	0.100 to 5.000 %	1-2 Display method: STND, SCAL
			0.100 to 9.999	1-2 Display method: FREQ
1-8 Low-limit display value deviation correction <sup>03)</sup>	I n b L	00	-99 to 99	1-2 Display method: STND, SCAL
1-9 Exponent of INB	I n b E	10 - 0	10-0: 10 <sup>0</sup> , 10-1: 10 <sup>-1</sup> , 10-2: 10 <sup>-2</sup> , 10 1: 10 <sup>1</sup>	1-2 Display method: FREQ

01) Displays at AC voltage or AC current model only.  
02) Scale display range and frequency measurement range are variable according to decimal point position.

Dot	Scale display range	Frequency measurement range
0	-1999 to 9999	1 to 9999 Hz
0.0	-199.9 to 999.9	0.1 to 999.9 Hz
0.00	-19.99 to 99.99	0.10 to 99.99 Hz
0.000	-1.999 to 9.999	0.100 to 9.999 Hz

03) Low-limit display value deviation correction range is within -99 to 99 for D<sup>0</sup>, D<sup>-1</sup> digit regardless of decimal point position.

Parameter 2 group

Parameter	Mark	Defaults	Setting range	Display condition
2-1 Output operation mode	o U t t	o F F	[Except indicator model] OFF, L.ST, H.ST, LH.ST, HH.ST, LL.ST, LD.ST • Refer to Output Operation Mode	-
2-2 Hysteresis	H Y S	00 I	[Except indicator model] Within 10 % of max. display range, digit	2-1 Output operation mode: except OFF
2-3 Startup compensation time	5 t R t	000	[Except indicator model] 0.0 to 99.9 sec	
2-4 Peak monitoring delay time	P E t t	00 5	00 to 30 sec	-
2-5 Display cycle	d i S t	0.2 5	0.1 to 5.0 sec	-
2-6 Keys for zero adjustment	z e r o	n o	NO, YES • YES: Press the [◀] + [▲] keys for 3 sec to adjust zero.	-
2-7 External input terminal	E u i n	H o l d	[Except indicator model] HOLD, ZERO • If the external input terminal is short-circuited for 50 ms or more, it operates with the set function.	-
2-8 High-limit value of transmission output	F 5 - H	5000	[DC voltage & Transmission (DC 4 - 20 mA) output model], [AC voltage & Transmission (DC 4 - 20 mA) output model] Max. value of display range	-
		5.000	[DC current & Transmission (DC 4 - 20 mA) output model], [AC current & Transmission (DC 4 - 20 mA) output model] Max. value of display range	
2-9 Low-limit value of transmission output	F 5 - L	0000	[DC voltage & Transmission (DC 4 - 20 mA) output model], [AC voltage & Transmission (DC 4 - 20 mA) output model] Min. value of display range	-
		0.000	[DC current & Transmission (DC 4 - 20 mA) output model], [AC current & Transmission (DC 4 - 20 mA) output model] Min. value of display range	
2-10 Comm. Address	R d r S	0 I	[RS485 Comm. output model] 01 to 99	-
2-11 Comm. speed	b P S	9600	[RS485 Comm. output model] 38.4k, 19.2k, 9600, 4800, 2400, 1200 bps	-
2-12 Parity bit	P r t y	n o n E	[RS485 Comm. output model] NONE, EVEN, ODD	-
2-13 Stop bit	5 t P	2	[RS485 Comm. output model] 2, 1 bit	-
2-14 Response waiting time	r S t t	5	[RS485 Comm. output model] 5 to 99 sec	-
2-15 Lock	L o C	o F F	OFF: unlock, LOC1: lock parameter 1, LOC2: lock parameter 1, 2, LOC3: lock parameter 0, 1 and 2	-

Parameter 0 group

Parameter	Mark	Defaults	Setting range	Display condition
0-1 Output high-limit output setting value	H S E t	5000	[DC voltage & Preset setting model] -5 to 110 % of display range [AC voltage & Preset setting model] 0 to 110 % of display range	2-1 Output operation mode: except OFF
		5.000	[DC current & Preset setting model] -5 to 110 % of display range [AC current & Preset setting model] 0 to 110 % of display range	
0-2 Output low-limit output setting value	L S E t	0000	[DC voltage & Preset setting model] -5 to 110 % of display range [AC voltage & Preset setting model] 0 to 110 % of display range	2-1 Output operation mode: except OFF
		0.000	[DC current & Preset setting model] -5 to 110 % of display range [AC current & Preset setting model] 0 to 110 % of display range	
0-3 Display max. peak value <sup>01)</sup>	H P E t	00	[DC voltage], [AC voltage] Max. peak value in run mode	2-1 Output operation mode: except OFF
		0.000	[DC current], [AC current] Max. peak value in run mode	& 2-4 Peak monitoring delay time: except 00
0-4 Display min. peak value <sup>01)</sup>	L P E t	00	[DC voltage], [AC voltage] Min. peak value in run mode	
		0.000	[DC current], [AC current] Min. peak value in run mode	

01) Reset: Press any one of [◀], [▼], [▲] keys.

Input Range and Display Range

When the max. input value is over the 100 %, it may result in input terminal damage.

DC voltage model

Input range	Display range		Input impedance
	Diaplay method: STND (fixed)	Diaplay method: SCAL <sup>01)</sup>	
0 - 500 VDC≈	0.0 to 500.0	5000	4.33348 MΩ
0 - 100 VDC≈	0.0 to 100.0	1000	4.33348 MΩ
0 - 50 VDC≈	0.00 to 50.00	500	433.48 kΩ
0 - 10 VDC≈	0.00 to 10.00	100	433.48 kΩ
0 - 5 VDC≈	0.000 to 5.000	50	43.48 kΩ
0 - 1 VDC≈	0.000 to 1.000	10	43.48 kΩ
0 - 250 mVDC≈	0.0 to 250.0	0.250	2.28 kΩ
0 - 50 mVDC≈	0.00 to 50.00	500	2.28 kΩ

01) Connect to the input terminals whose 30 % to 100 % of the input range includes the max. value of the input range to measure.  
When the max. input value is under the 30 % of the input terminal range, display accuracy is degraded.

DC current model

Input range	Display range		Input impedance
	Diaplay method: STND (fixed)	Diaplay method: SCAL <sup>01)</sup>	
0 - 5 A	0.000 to 5.000	5R	0.022 Ω
0 - 2 A	0.000 to 2.000	2R	0.022 Ω
0 - 500 mA	0.0 to 500.0	0.5R	0.222 Ω
0 - 200 mA	0.0 to 200.0	0.2R	0.222 Ω
0 - 50 mA	0.00 to 50.00	500	2.222 Ω
4 - 20 mA	4.00 to 20.00	4 ~ 20	2.222 Ω
0 - 5 mA	0.000 to 5.000	500	22.222 Ω
0 - 2 mA	0.000 to 2.000	200	22.222 Ω

01) Connect to the input terminals whose 30 % to 100 % of the input range includes the max. value of the input range to measure.  
When the max. input value is under the 30 % of the input terminal range, display accuracy is degraded.

AC voltage model


Input range	Display range		Input impedance
	Diaplay method: STND (fixed)	Diaplay method: SCAL <sup>01)</sup>	
0 - 500 VAC~	0.0 to 500.0	5000	5.01092 MΩ
0 - 250 VAC~	0.0 to 250.0	2500	5.01092 MΩ
0 - 110 VAC~ <sup>02)</sup>	0.0 to 440.0	1100	1.11092 MΩ
0 - 50 VAC~	0.00 to 50.00	500	1.11092 MΩ
0 - 20 VAC~	0.00 to 20.00	200	200.92 kΩ
0 - 10 VAC~	0.00 to 10.00	100	200.92 kΩ
0 - 2 VAC~	0.000 to 2.000	200	20.92 kΩ
0 - 1 VAC~	0.000 to 1.000	100	20.92 kΩ

01) Connect to the input terminals whose 30 % to 100 % of the input range includes the max. value of the input range to measure.  
When the max. input value is under the 30 % of the input terminal range, display accuracy is degraded.  
02) In case of 0 to 110 VAC~ of AC voltage range and using P.T (potential transformer) for 440 VAC~ / 110 VAC~, if 110 VAC~ is input, and the unit displays 440 VAC~ automatically by preset scale value for P.T user's convenient.

AC current model

Input range	Display range		Input impedance
	Diaplay method: STND (fixed)	Diaplay method: SCAL <sup>01)</sup>	
0 - 5 A	0.000 to 5.000	5R	0.02 Ω
0 - 2.5 A	0.000 to 2.500	2.5R	0.02 Ω
0 - 1 A	0.000 to 1.000	1R	0.102 Ω
0 - 500 mA	0.0 to 500.0	0.5R	0.202 Ω
0 - 250 mA	0.0 to 250.0	0.25R	0.202 Ω
0 - 100 mA	0.0 to 100.0	0.1R	1.022 Ω
0 - 50 mA	0.00 to 50.00	500	1.022 Ω

01) Connect to the input terminals whose 30 % to 100 % of the input range includes the max. value of the input range to measure.  
When the max. input value is under the 30 % of the input terminal range, display accuracy is degraded.

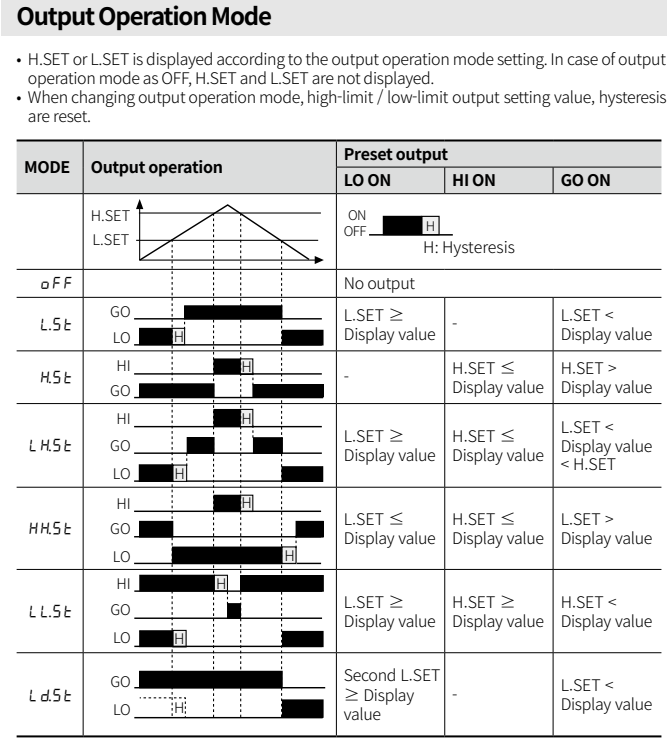

- Reset
01. Press the [◀] + [▲] + [▼] keys for over 5 sec. in run mode, INIT turns ON.

02. Change the setting value as YES by pressing the direction keys.

03. Press the [MODE] key to reset all parameter values as default and to return to run mode.

Error

Display	Description	Troubleshooting
HHHH	Flashes when measurement input is exceeded the max. allowable input (110 %)	Disconnect power supply and check the cables.
LLLL <sup>01)</sup>	Flashes when measurement input is exceeded the min. allowable input (-10 %)	
d - HH	Turns ON when display input is exceeded high-limit scale setting value or max. display range (9999)	Reset within the display range.
d - LL	Turns ON when display input is exceeded low-limit scale setting value or min. display range (-1999)	
F - HH	Turns ON when input frequency is exceeded the max. display value of measured range	-
o u E r	Flashes twice when it exceeds zero range (±99) and returns to run mode	Reset within the zero range.

01) Displays at DC input model only.